

AD-A055 714

NAVAL AIR DEVELOPMENT CENTER WARMINSTER PA AIRCRAFT --ETC F/G 11/6  
GALVANIC CORROSION FATIGUE TESTING OF 7075-T6 ALUMINUM BONDED W--ETC(U)  
JAN 78 S R BROWN, J J DE LUCCIA

UNCLASSIFIED

NADC-77328-60

NL

1 OF 1

AD  
A055 714




END

DATE  
FILMED

8 -78

DDC

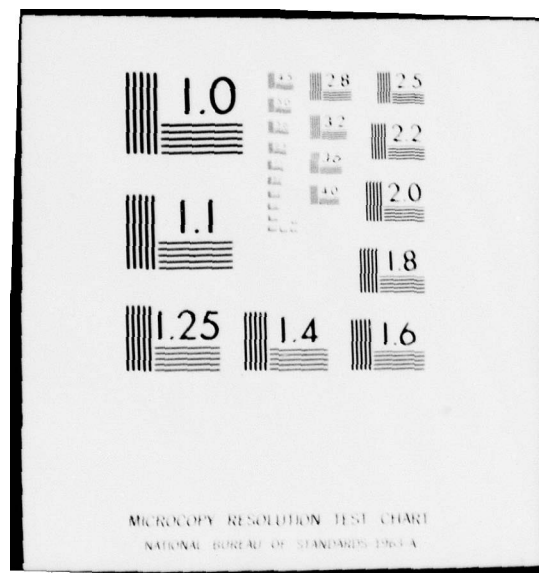

FOR FURTHER TRAN

AD A 055714

REPORT NO. NADC-77328-60




6 GALVANIC CORROSION FATIGUE TESTING OF 7075-T6  
ALUMINUM BONDED WITH GRAPHITE-EPOXY COMPOSITE

10 S. R. Brown and J. J. De Luccia  
Aircraft and Crew Systems Technology Directorate  
NAVAL AIR DEVELOPMENT CENTER  
Warminster, Pennsylvania 18974

11 10 JAN 1978

12 18 p.

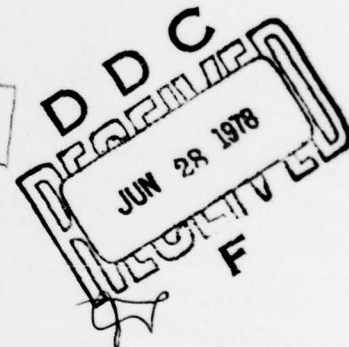

17 PHASE REPORT

AIRTASK NO. ZF54590-001  
Work Unit No. ZM601

16 F54590

9 Phase rpt.,

APPROVED FOR PUBLIC RELEASE; DISTRIBUTION UNLIMITED

Prepared for  
NAVAL AIR SYSTEMS COMMAND  
Department of the Navy  
Washington, D.C. 20361

78 06 26 065

393 532 not

AD No. \_\_\_\_\_  
DDC FILE COPY


## NOTICES

**REPORT NUMBERING SYSTEM** - The numbering of technical project reports issued by the Naval Air Development Center is arranged for specific identification purposes. Each number consists of the Center acronym, the calendar year in which the number was assigned, the sequence number of the report within the specific calendar year, and the official 2-digit correspondence code of the Command Office or the Functional Directorate responsible for the report. For example: Report No. NADC-78015-20 indicates the fifteenth Center report for the year 1978, and prepared by the Systems Directorate. The numerical codes are as follows:

CODE	OFFICE OR DIRECTORATE
00	Commander, Naval Air Development Center
01	Technical Director, Naval Air Development Center
02	Comptroller
10	Directorate Command Projects
20	Systems Directorate
30	Sensors & Avionics Technology Directorate
40	Communication & Navigation Technology Directorate
50	Software Computer Directorate
60	Aircraft & Crew Systems Technology Directorate
70	Planning Assessment Resources
80	Engineering Support Group

**PRODUCT ENDORSEMENT** - The discussion or instructions concerning commercial products herein do not constitute an endorsement by the Government nor do they convey or imply the license or right to use such products.

APPROVED BY:

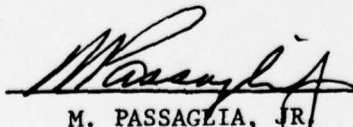  
M. PASSAGLIA, JR.  
Captain, USN  
Deputy Director, ACSTD

DATE:

10 Jan 1978

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER NADC-77328-60 ✓	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) Galvanic Corrosion Fatigue Testing of 7075-T6 Aluminum Bonded With Graphite-Epoxy Composite		5. TYPE OF REPORT & PERIOD COVERED Phase
		6. PERFORMING ORG. REPORT NUMBER
7. AUTHOR(s) S. R. Brown and J. J. De Luccia		8. CONTRACT OR GRANT NUMBER(s)
9. PERFORMING ORGANIZATION NAME AND ADDRESS Naval Air Development Center Aircraft and Crew Systems Technology Directorate Warminster, Pennsylvania 18974		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS AIRTASK NO. ZF 54 590 001 Work Unit No. ZM601
11. CONTROLLING OFFICE NAME AND ADDRESS		12. REPORT DATE 10 January 1978
		13. NUMBER OF PAGES 19
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		15. SECURITY CLASS. (of this report) Unclassified
		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report) Approved for public release; distribution unlimited		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Galvanic Corrosion Aluminum Alloy 7075-T6 Graphite-Epoxy Composite Fatigue Testing Accelerated Testing		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) Galvanic corrosion effects were determined on 7075-T6 aluminum with attached, adhesively bonded sections of graphite-epoxy composite material. Fatigue tests were conducted on specimens exposed to a sulfur dioxide-salt spray environment in a chamber constructed on a Krouse direct-stress fatigue machine. S-N curves were developed under tension-tension conditions (R = 0.1) and with unprotected specimens, a 20 percent reduction in fatigue life was attributed to the contacting graphite-epoxy composite material. Protective coatings and nonconductive barriers to break the galvanic		

DD FORM 1 JAN 73 1473

EDITION OF 1 NOV 65 IS OBSOLETE  
S/N 0102-LF-014-6601

UNCLASSIFIED


SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)



UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

corrosion circuit were evaluated under the same corrosion fatigue (tension-tension) test conditions. Epoxy primer-polyurethane paint systems, polysulfide sealants and glass cloth barriers were used to measure their effectiveness in galvanic corrosion control. Metallograph and SEM (Scanning Electron Microscope) observations were made of corrosion sites and fatigue surfaces.



S/N 0102- LF- 014- 6601

Unclassified

SECURITY CLASSIFICATION OF THIS PAGE(When Data Entered)

## I N T R O D U C T I O N

Graphite-epoxy composite is a relatively new airframe material with a high-strength-to-weight-ratio and a high modulus that achieves weight reductions of 25 to 50 percent for selected components. Unfortunately, graphite (carbon) is near the low potential (cathodic) end of the galvanized series with an open circuit potential of +170mV while 7075-T6 is at the high potential (anodic) end with a -770mV reading in 3.5% NaCl (reference (a)). With two widely dissimilar conductive materials such as aluminum and graphite in contact in a salt water environment, galvanic corrosion of the aluminum is experienced.

Early research and development efforts on graphite-epoxy composite materials centered on mechanical and structural behavior with only limited efforts directed to corrosion problems and prevention. In reference (b), work on the compatibility of graphite-epoxy composites with metallic materials identified the galvanic corrosion problem. Reference (a) is a significant study conducted at NAVAIRDEVCEEN with electrochemical and stress corrosion cracking (SCC) data obtained to define and evaluate the potential galvanic corrosion problem in the naval air-sea environment.

An extension of these efforts has been undertaken by fatigue testing aluminum/graphite-epoxy composite couples in a realistic corrosive environment encountered by Naval aircraft. Galvanic corrosion effects on fatigue life were determined by conducting tension-tension fatigue tests on 7075-T6 aluminum specimens with adhesively bonded graphite-epoxy tabs. A sulfur dioxide-salt spray environment was chosen as the corrosion medium since it is a significant accelerated corrosion test for materials used in Naval aircraft (reference (c)).

ADDITION for	
AVIS	Write Section <input checked="" type="checkbox"/>
EOC	Full Section <input type="checkbox"/>
INDEXED	<input type="checkbox"/>
15 JUL 78	
BY	
DISPATCHED FOR MAIL ROOM	
CIR	
A	

NADC-77328-60

## PROCEDURE

### TEST UNIT

A salt spray chamber was installed on a Krouse direct stress fatigue machine to study graphite-epoxy/metal alloy combinations in a sulfur dioxide-salt spray environment. The fatigue machine, chamber and support equipment are shown in Figure 1.

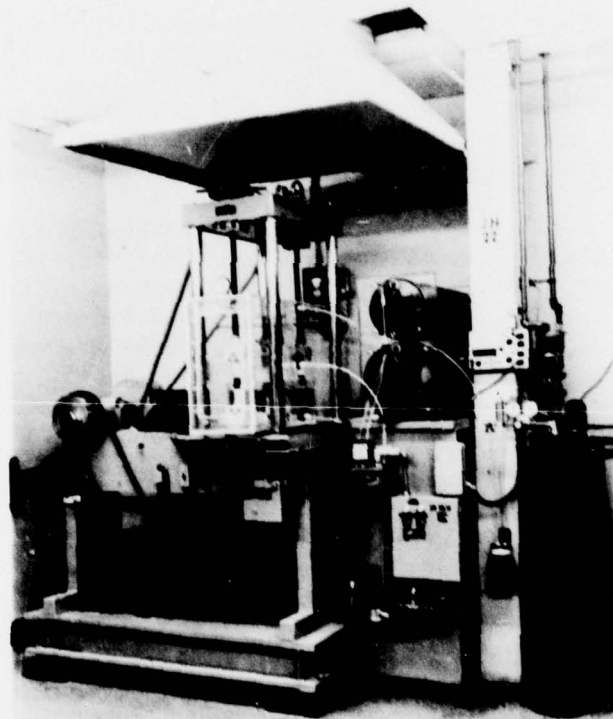


Figure 1 - Galvanic Corrosion-Fatigue Test Unit



The chamber is 2 ft. high by 1 ft. wide by 3 ft. deep and constructed of 0.5 in. thick acrylic plastic. Removable end panels provide access to the two test stations. An atomizing nozzle and tower in the chamber plus the external humidifying tower and solution reservoirs provide the 5 percent salt fog environment. Sulfur dioxide gas injection equipment includes a flowmeter, solenoid valve, timer and compressed gas storage cylinder.

#### SPECIMENS

Fatigue specimens were made from 0.063 in. thick 7075-T6 unclad aluminum sheet. Specimens were fabricated with the direction of rolling in the longitudinal direction of the panel so failure would occur in the transverse direction. Graphite-epoxy tabs were laid up using six layers of Hercules "MagnaMite" 3501/AS1-6 graphite prepreg and "stepped" to minimize stress concentrations at the bond junction to the aluminum specimens. Hysol EA9309 was used to adhesively bond graphite-epoxy tabs to aluminum fatigue specimens as shown in Figure 2. Bonding conditions were 117 kPa (17 psi) in an autoclave at room temperature for 24 hours. A room temperature cure epoxy was used to avoid strength level changes of the aluminum.

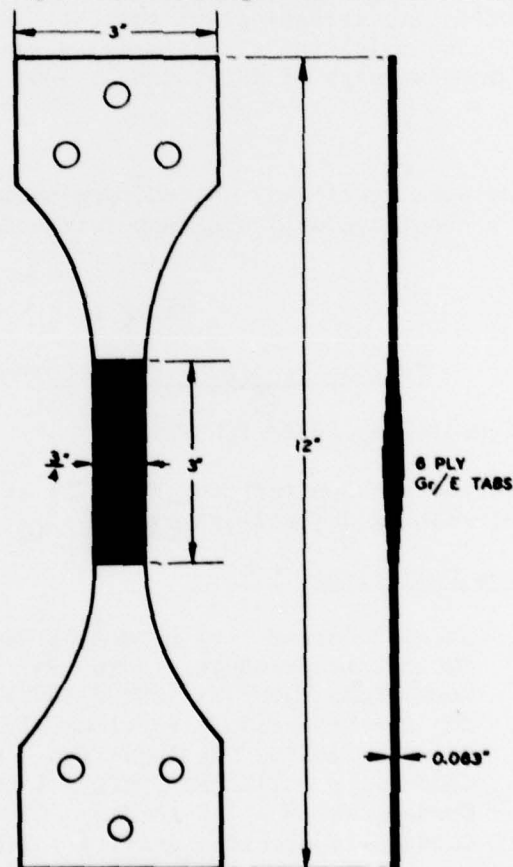


Figure 2 - Galvanic Corrosion Fatigue Specimen Graphite-Epoxy Bonded to Aluminum

## TREATMENTS AND COATINGS

Aluminum surfaces were pretreated with the conventional FPL (Forest Products Laboratory) etch prior to adhesive bonding. The FPL treatments were as follows:

Distilled water	68% by weight
Concentrated sulfuric acid	23% by weight
Sodium dichromate	9% by weight

Immersion conditions - 20 minutes at 165-70°C

The bending process was started within eight hours of the FPL etch treatment to avoid adverse reaction on the aluminum surface.

Protective coatings applied to prevent corrosion included: MIL-S-8802 D(2), Class A-2 polysulfide sealant, MIL-P-23377 epoxy primer and MIL-C-81773 aliphatic polyurethane paint topcoat. A barrier coating to separate (electrically uncouple) the graphite-epoxy tabs from the aluminum was fabricated from two plys of 3M Scotchply 1003 made with "K" filament.

## TEST METHOD

Specimens were statically loaded, presoaked (exposed to the corrosion environment without cycling) and then fatigued under test parameters given in Table 1.

TABLE I

### Tension-Tension Fatigue Corrosion Test

Presoak - 16 hours in SO<sub>2</sub>-salt spray fog

Fatigue - Tension-tension fatigue (R = 0.1) at 1200 cpm  
maintaining SO<sub>2</sub>-salt spray fog

### SO<sub>2</sub>-Salt Spray Conditions

Spray Solution - 5% by weight NaCl, pH 6.5-7.2  
Cabinet temperature - 35°C (95°F)  
Tower temperature - 46°C (114°F)  
SO<sub>2</sub> gas injection - continuously 1 hr/6 hr cycle  
SO<sub>2</sub> gas flow during injection - 6 to 8 cc/min  
Condensate collection rate - 1 to 2 mls/hr  
Condensate pH - 2.5 to 3.2  
Condensate specific gravity - 1.025 to 1.040

## RESULTS AND DISCUSSION

## TENSION-TENSION FATIGUE

Fatigue life of bare 7075-T6 was reduced from 150,000 cycles at the 40 ksi stress under ambient conditions to 8,400 cycles (FPL etched) under the same stress when exposed to sulfur dioxide-salt spray as given in Table I. A further reduction to 6,400 cycles was experienced with bonded graphite-epoxy tabs due to the galvanic coupling effect. This is shown in Figure 3.

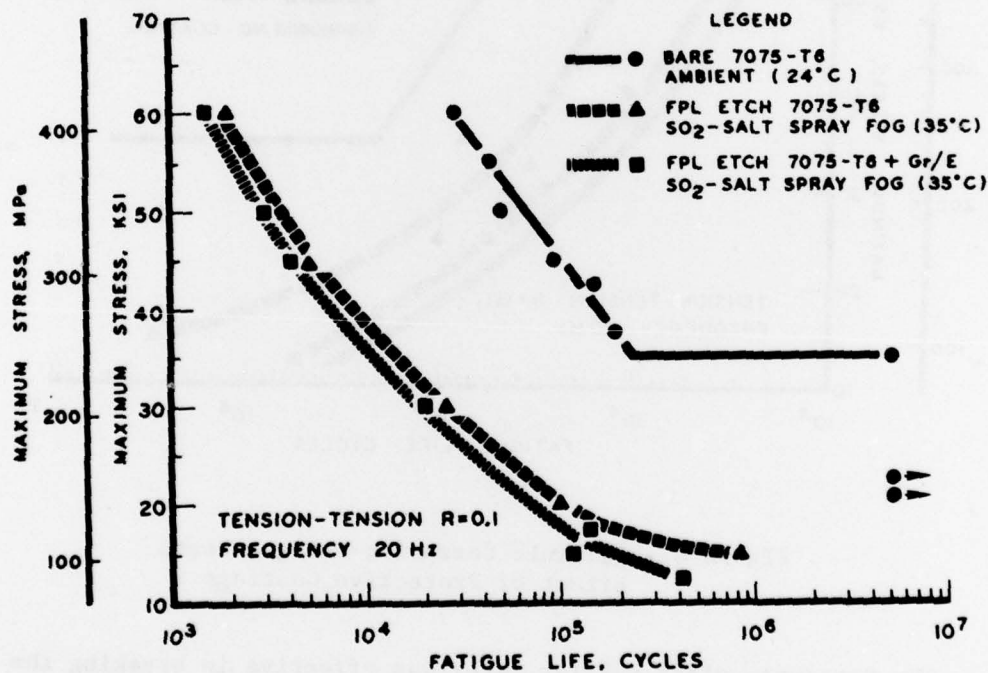


Figure 3 - Galvanic Corrosion Fatigue Tests Without Protective Coatings

A degree of baseline fatigue life (bare 7075-T6 at ambient conditions) was recovered by applying protective coatings of polysulfide sealant to the coupled edges and overcoating with inhibited epoxy primer-polyurethane topcoat. This protective scheme provided an additional 20,000 cycles of fatigue life at 40 ksi over the uncoated condition as shown by the "sealant and paint" curve in Figure 4.

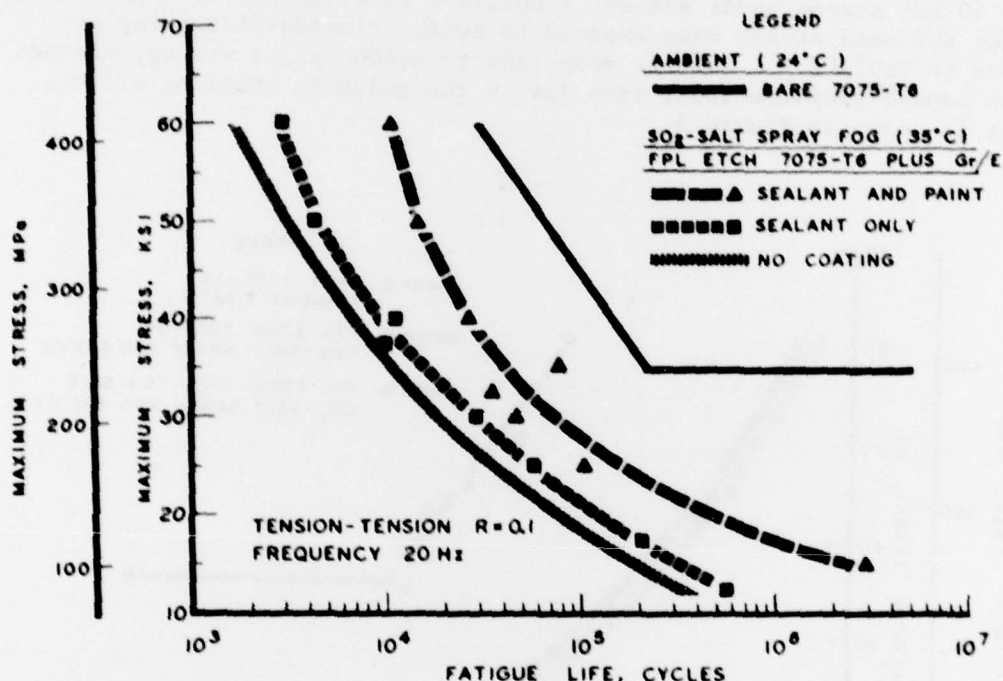


Figure 4 - Galvanic Corrosion-Fatigue Tests  
Effect of Protective Coatings

The Scotchply glass barrier layer was effective in breaking the galvanic couple between the graphite-epoxy tabs and aluminum fatigue specimens. Resistance across regular adhesively bonded graphite-epoxy to aluminum was measured as 60-100 ohms. With the glass barrier cloth acting as an insulator, resistance was 100 megaohms, a  $10^6$  - fold increase. The S-N curve for specimens with the glass cloth barrier bonded between the graphite-epoxy and aluminum, exposed to the corrosive environment, is shown in Figure 5.



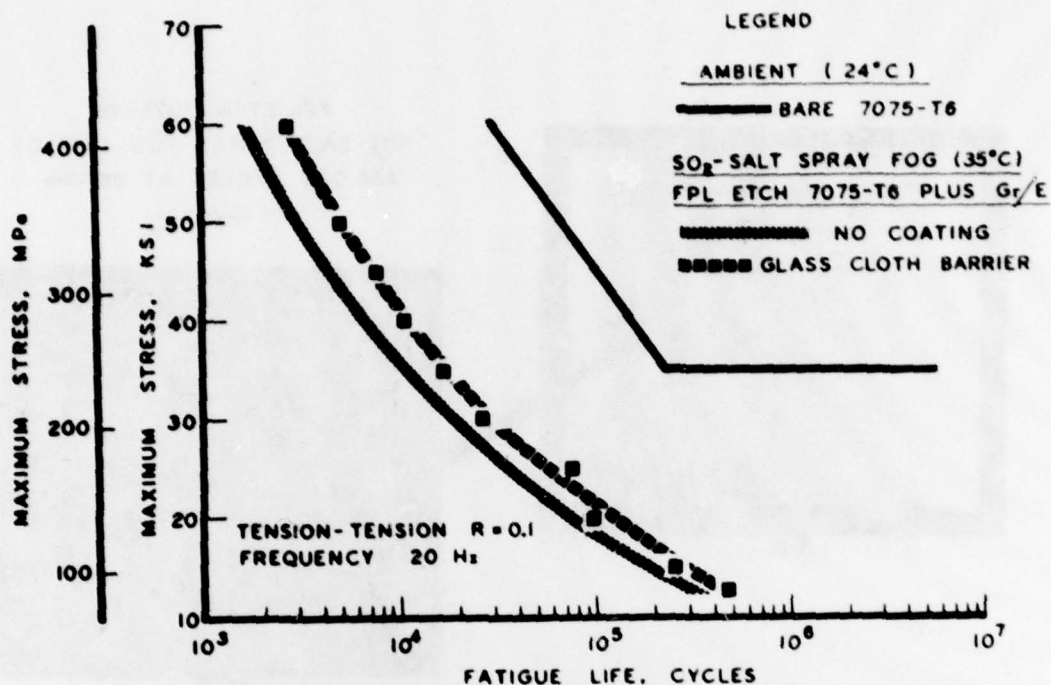


Figure 5 - Galvanic Corrosion Fatigue Tests  
with Glass Cloth Barrier

It should be noted that the glass cloth restored fatigue life to the aluminum to the same extent as the use of sealants. In both cases, the galvanic circuit between the aluminum and the composite is eliminated.

#### CORROSION OBSERVATIONS

Corrosion of the 7075-T6 aluminum in the proximity of the graphite-epoxy composite is shown in the Figure 6 macrophotographs. Pitting is most severe on the panel edge and at the aluminum/graphite-epoxy tab boundary. The basket weave pattern in the retained adhesive layer is simply an impression of the peel-ply from the graphite prepreg after removal of the graphite-epoxy tab.




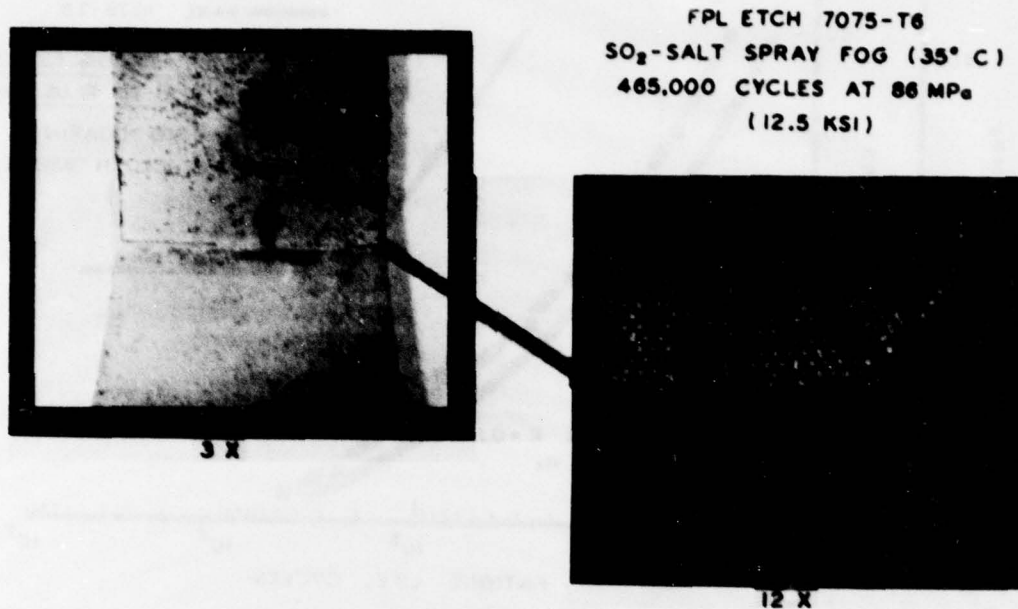


Figure 6 - Corrosion of 7075-T6 Fatigue Specimens  
Evident After Removal of Graphite-Epoxy Composite Tab

Figure 7 is a SEM study of a corroded aluminum surface area from Figure 6. Intergranular corrosion is quite evident in the magnified views and was accelerated by the proximity of the graphite-epoxy to the aluminum.


The photomicrographs of Figure 8 are of the same specimens as shown in Figures 6 and 7, but were taken at the opposite end of the graphite-epoxy tab where the fatigue failure occurred. The cross-section was made across a deep pit that developed in the aluminum at the end of the graphite-epoxy tab. This pit, or a similar pit, served to initiate fatigue failure of their specimen. Mount supports shown in the upper portions of the Figure 8 (a) and (b) are not part of the specimen.

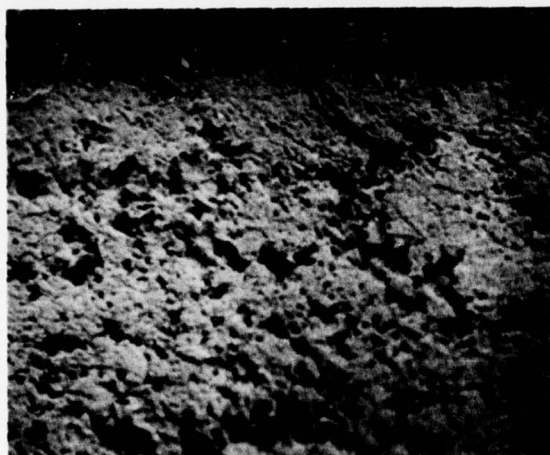


(a) Magnification X50



(b) Magnification X100

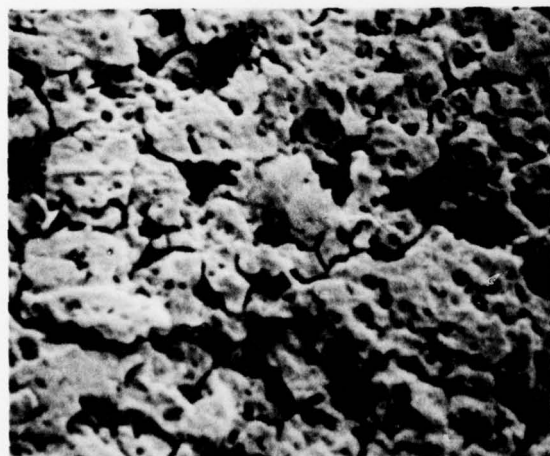

(c) Magnification X200

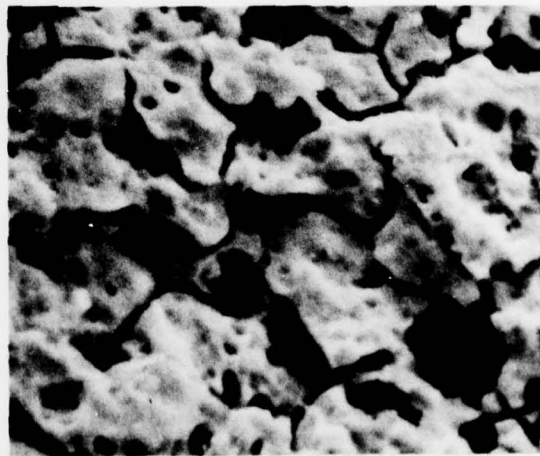


(d) Magnification X500

Figure 7 - Scanning Electron Micrographs of FPL Etched 7075-T6 Surface  
Near Graphite-Epoxy Composite, Specimen Exposed to  $\text{SO}_2$  -  
Salt Spray and Fatigued at 86MPa for 465,000 Cycles



(a) Magnification X50

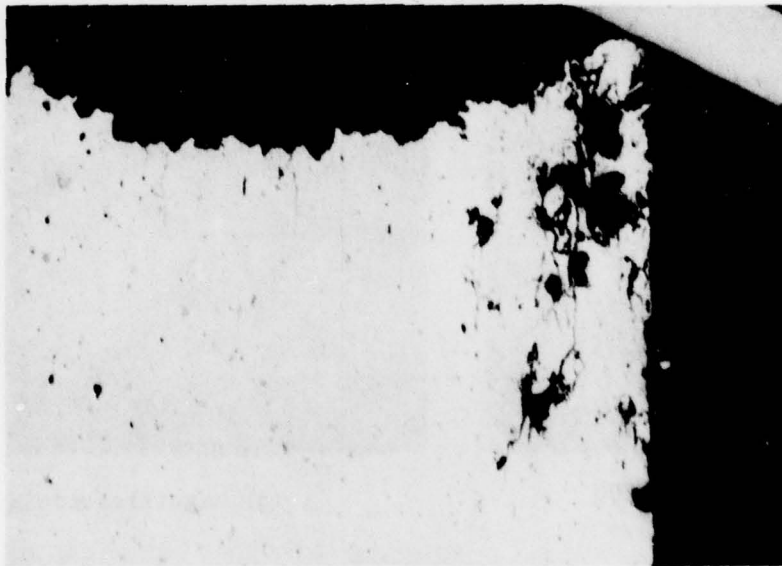

(b) Magnification X100

Figure 8 - Cross Section of 7075-T6 Fatigue Failure  
After Tension-Tension Fatigue Corrosion  
Test. Fatigued at 86 MPa for 465,000 Cycles.

Fatigue failures originated from pitting sites at graphite-epoxy and aluminum intersections. Figure 9 shows an isometric view of an aluminum specimen in the vicinity where the graphite-epoxy tab was attached. Note the severe pitting of the aluminum. These pits act to concentrate stress and initiate fatigue cracking.

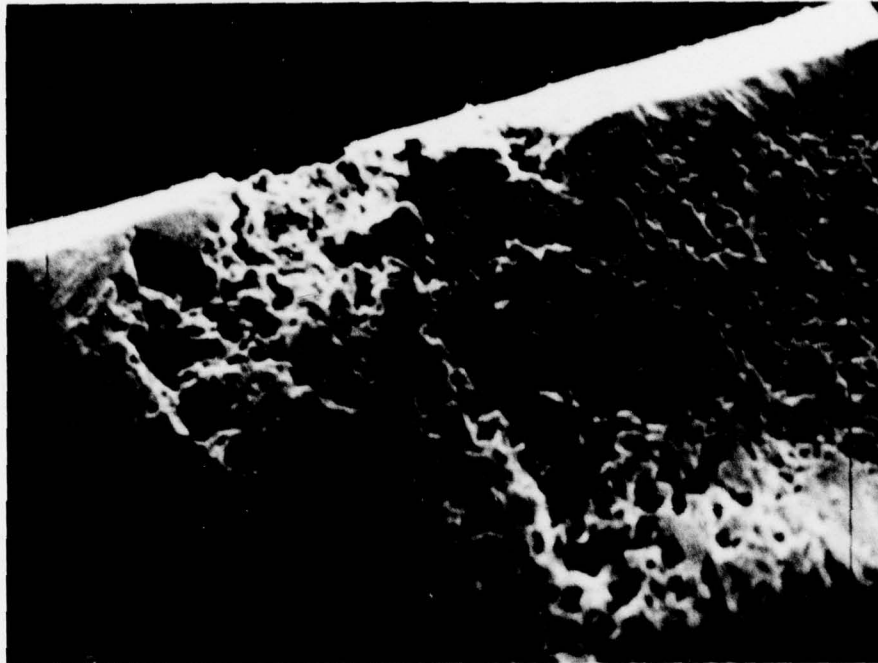


Figure 9 - Scanning Electron Micrograph of Pitting Corrosion in 7075-T6 Aluminum at Graphite-Epoxy/Aluminum Interface (Original Magnification - 100X)

An examination of a fracture surface (Figure 10) reveals fatigue striations as well as pits (circular dark areas) after failure in the sulfur dioxide-salt spray test environment.

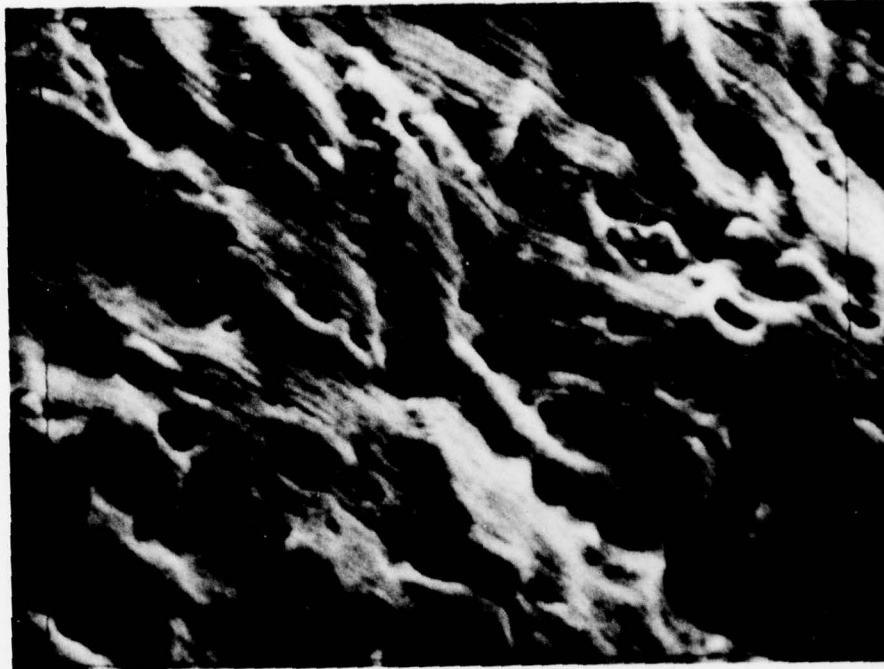


Figure 10 - Scanning Electron Micrograph of Galvanic Corrosion  
Fatigue Fracture Surface (Original Magnification 500X)

Figures 9 and 10 were photographically enlarged about 25 percent  
over original magnification.



### C O N C L U S I O N S

1. The sulfur dioxide-salt spray environment significantly reduces S-N curve fatigue life of 7075-T6 aluminum. Additional fatigue life loss is experienced with graphite-epoxy composite bonded to bare aluminum because of the galvanic corrosion effect. Accelerated pitting caused by the galvanic effect acts to provide stress concentrations that nucleate fatigue cracks.
2. Application of protective coating systems vastly improves fatigue life of the 7075-T6 aluminum with adhesively bonded graphite-epoxy composite exposed to the sulfur dioxide-salt spray test environment. The system used was MIL-S-8802 polysulfide sealant applied to composite/aluminum junctions and coating exposed surfaces with MIL-P-23377 inhibited epoxy primer and MIL-C-81773 polyurethane paint topcoat.
3. A glass cloth barrier bonded between the graphite-epoxy composite and 7075-T6 aluminum effectively prevented accelerated pitting due to galvanic corrosion.

### R E C O M M E N D A T I O N S

The combination of a nonconductive barrier to break the internal galvanic corrosion circuit plus sealant and paint coatings to exclude external corrosion is recommended to control corrosion at junctions of graphite-epoxy composite and aircraft alloys.

### F U T U R E P L A N S

FM 300, an adhesive being used to bond graphite-epoxy layers to aluminum honeycomb in the F-18, will be evaluated as a barrier coating since it has a tight weave scrim cloth. The FM300 will be compared to 3M Scotchply 1003 glass cloth with and without protective overcoat systems.

### A C N O W L E D G E M E N T

The assistance of Mr. P. J. Sabatini with the test system installation and the test program is gratefully acknowledged.

R E F E R E N C E S

- (a) Fischer, P. and De Luccia, J. J., "Effects of Graphite/Epoxy Composite Materials on the Corrosion Behavior of Aircraft Alloys," Report No. NADC-75031-30, Naval Air Development Center, Warminster, PA, 3 April 1975.
- (b) Sederman, R. R. and Weber, K. E., "Investigation of Galvanic Corrosion Associated with Filamentary Composites in Contact with Aircraft Structural Metals," Technical Brief, Lockheed California Company Burbank, CA, 1970.
- (c) Ketcham, S. J., "Accelerated Laboratory Corrosion Test for Materials and Finishes Used in Naval Aircraft", Report No. NADC-77252-30, Naval Air Development Center, Warminster, PA, 14 Sep 1977.